

## TECHNICAL NOTE



### Operating mode recommendation for **HISpower series** TO-8 Thermal Infrared Emitters

INFRA·SOLIDs infrared (IR) emitter are powerful and high-efficient IR radiation sources that meet the demands for reliable and high-precision gas sensors and offer a wide range of application scenarios in IR spectroscopy. Infrasonics IR emitters are characterized by a very low temperature coefficient of electrical resistance. Therefore the hot resistance and the cold resistance are almost identical which eases the electrical control of the IR sources.

All IR sources can be driven in electrical voltage, current or power regulated mode. The application decides whether the operating mode is DC or AC (pulsed). Depending on the drive mode and the applied electrical power the electrical resistance of the IR emitter can change over time. For highest measurement accuracy a power regulated mode is always recommended for thermal IR emitters. However, it is the most complex operating mode and not suitable in all applications.

For applications that require a small and low-cost driving circuit with a maximum stability close to a power regulated mode a simple circuit with an adjustable low drop-out voltage (LDO) regulator is proposed (Fig. 1). The LDO regulator is a linear voltage regulator that regulates the drive voltage of the IR emitter even when the supply voltage is very close to the output voltage. This enables a wide range of input voltage and is also of advantage in battery-powered applications. A single external resistor  $R3$  is used to set a current limit and, hence, a power limit. If the circuit is correctly dimensioned and adjusted in its operating point to the electrical resistance of the IR emitter, the electrical drive power remains constant for small resistance changes and over a wide input voltage and temperature range.

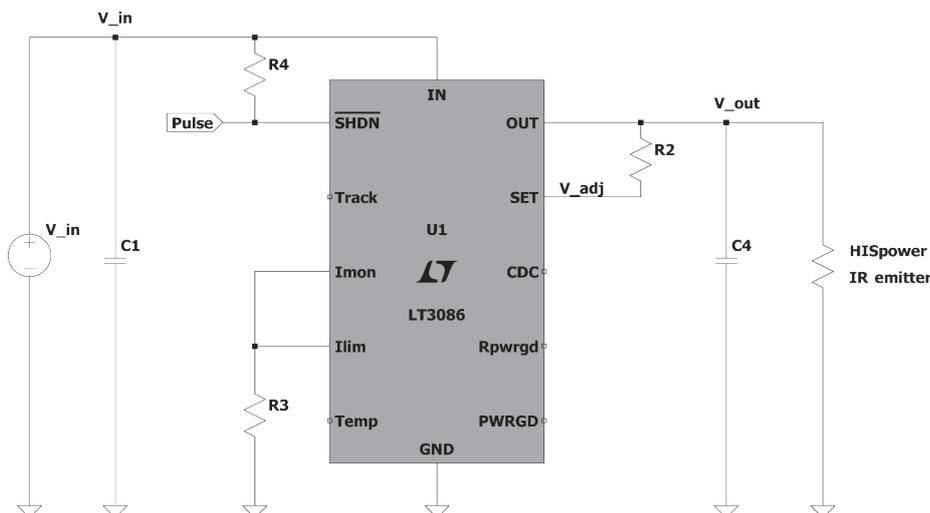


Fig. 1: Application circuit to drive HISpower series IR emitters with the LDO regulator LT3086.

## Set of parameters for maximum operating power

Part	HISpower series
	HIS2000R
$R_{Emitter}$	5.8 $\Omega$
$R2$	68.1 k $\Omega$
$R3$	1.21 k $\Omega$
$R4$	510 k $\Omega$
C1	10 $\mu$ F
C2	n/a
C3	n/a
C4	10 $\mu$ F
LDO regulator U1	LT3086
Input voltage ( $V_{in}$ )	(4.3 ... 6) V
Pulse signal voltage	Low/OFF: (0 ... 1) V High/ON: 1.5 V ... $V_{in}$
Drive power	2500 mW

Table 1: Set of parameters to drive HISpower series IR emitters at its maximum operating power.

The drive power  $P$  of the IR emitter is set with the two resistors  $R2$  and  $R3$ . For correct dimensioning, the following equations must be used to calculate the required resistance values for a given drive power  $P$  and a given electrical (hot) resistance  $R_{Emitter}$  of the IR emitter:

$$R2 = \frac{\sqrt{P * R_{Emitter}} - 0.4 \text{ V}}{50 \mu\text{A}}$$

$$R3 = 1000 * \frac{0.8 \text{ V}}{\sqrt{\frac{P}{R_{Emitter}}}}$$

It is recommended to use resistors with 1 % tolerance or less (E96 or E192 series) to set the drive power. This keeps drift to a minimum and achieves maximum stable operation. All other parameters are kept constant as given in Table 1. For DC mode operation the pulse signal voltage has to be set to HIGH state or input voltage  $V_{in}$ .

## Driving circuit board

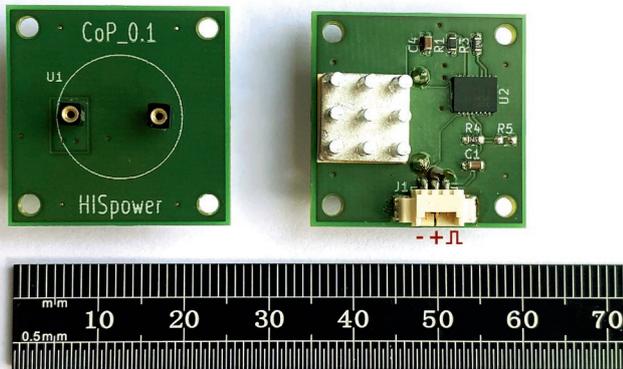


Fig. 2: Driving circuit board for a quick evaluation of HISpower series IR emitters.

For a quick evaluation of HISpower series IR emitters we offer a simple driving circuit board (Fig. 2). Please contact us for further technical details and ordering information. We will be pleased to support you on choosing the optimal drive mode for your system and application.